

# FAQ N510 Software Update Over The Air (Suota)

## Introduction

The SUOTA functionality provides the possibility to upgrade DECT handsets software Over-The-Air.

To use this feature, you need to use the selected base-station and special handsets, additional memory is needed to support this feature.

This feature is supported by:

- N510IP PRO:
  - Software 238 or higher


### Important

- When a repeater is registered to the N510, SUOTA is disabled. Even when the repeater is powered down, SUOTA is still disabled and the handset update will not work. A solution could be to deregister all registered repeaters or bring a spare N510 to update the handset(s) via this device.
- Encryption should be enabled

- Handsets:
  - R650H PRO
  - S650H PRO (BL60 or higher)
  - SL750H PRO (BL61 or higher)  
*If your SL750 handset has software 60, please use quick sync via USB cable to upgrade to newer version.*

## N510 setting

Open the web-interface of the N510 and go to: **Settings - Management - Firmware update**

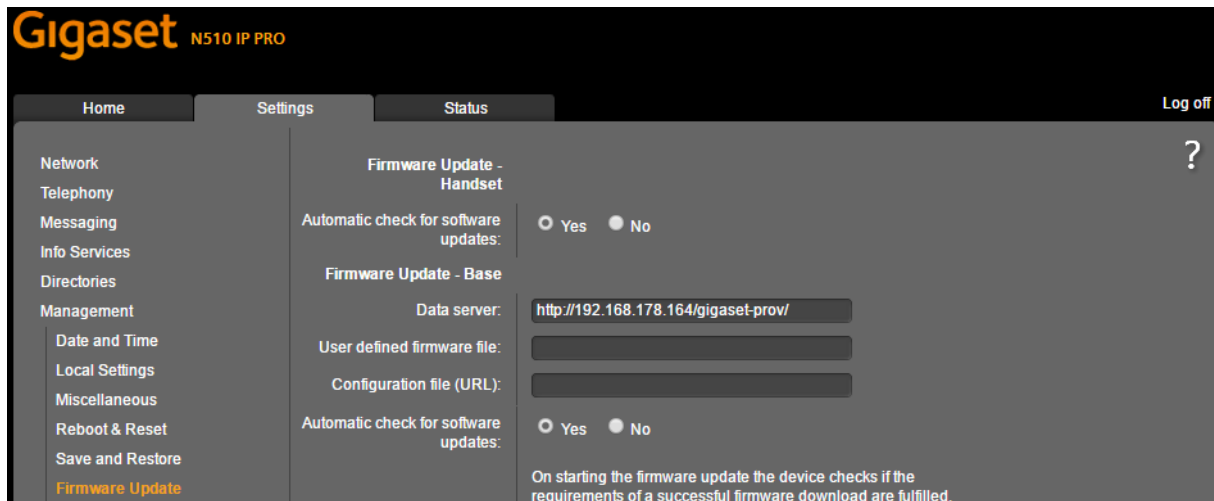

**Firmware Update Handset** should be enabled.

## Show / start Firmware update.

Handset has to be fully charged.

Open the Menu of the handset go to: **Settings - System - Handset Update**

Downloading the software will take 15-20 minutes.



#### **Important**

A handset will get the menu items during registration, if the handset was already registered to the N510 with software < 236 then the **Handset Update** menu item will not be visible. To solve this, de-register the handset and register it again.

## Current Version

Shows you the current version of the Handset software.

## Update

The device will check online if a new handset firmware is available.

- [Introduction](#)
- [N510 setting](#)
- [Show / start Firmware update.](#)
  - [Current Version](#)
  - [Update](#)